

ATTENTION:

GENERAL MANAGER
 PARTS MANAGER
 CLAIMS PERSONNEL
 SERVICE MANAGER

IMPORTANT - All
 Service Personnel
 Should Read and
 Initial in the boxes
 provided, right.



SUBARU[®]

QUALITY DRIVEN[®] SERVICE

SERVICE BULLETIN

APPLICABILITY: 2005MY Legacy 2.5L SOHC
 2005MY Outback 2.5L SOHC
 2005MY Impreza 2.5L SOHC
 2005MY Forester 2.5L SOHC

NUMBER: 16-69-07
DATE: 04/10/07

SUBJECT: 4EAT TCM Reprogramming Files for
 4-3 and 3-2 Downshift Shock

INTRODUCTION

This is to announce that TCM reprogramming files are now available for countermeasure against 4-3 and 3-2 downshift shock when temperatures are below 32°F / 0°C.

PACK FILE APPLICABILITY

PACK FILE NAME	PART # AFTER REPROGRAMMING	OLD PART #	MODEL	ENGINE/SPEC
31711AG831.pak	31711AG831	31711AG830	05MY Legacy	2.5L NA (FED)
31711AG851.pak	31711AG851	31711AG850	05MY Outback	2.5L NA (FED)
31711AG861.pak	31711AG861	31711AG860	05MY Legacy	2.5L NA (CAL)
31711AG881.pak	31711AG881	31711AG880	05MY Outback	2.5L NA (CAL)
31711AJ521.pak	31711AJ521	31711AJ520	05MY Impreza	2.5L NA (FED&CAL)
31711AJ361.pak	31711AJ361	31711AJ360	05MY Forester	2.5L NA (FED&CAL)

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

